


F180 MANUAL CORRECTIONS

Page 11, step 2.10

The orientation of the rear rockers is incorrect in the manual. The image on the right shows the correct orientation.

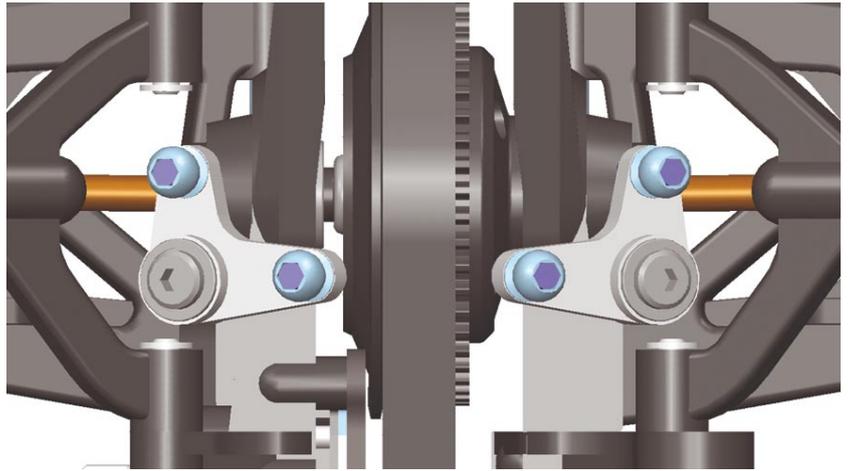

Page 13, step 3.2


Open "Bag I" on this step, not step 3.3 as stated in the manual.

Page 19, step 4.5

The length of the steering linkage should be set to 85mm, not 73.7mm.

Page 20, step 4.8

This step has a new assembly order and clarifies the brake lever and servo arm mounting which you can see below.

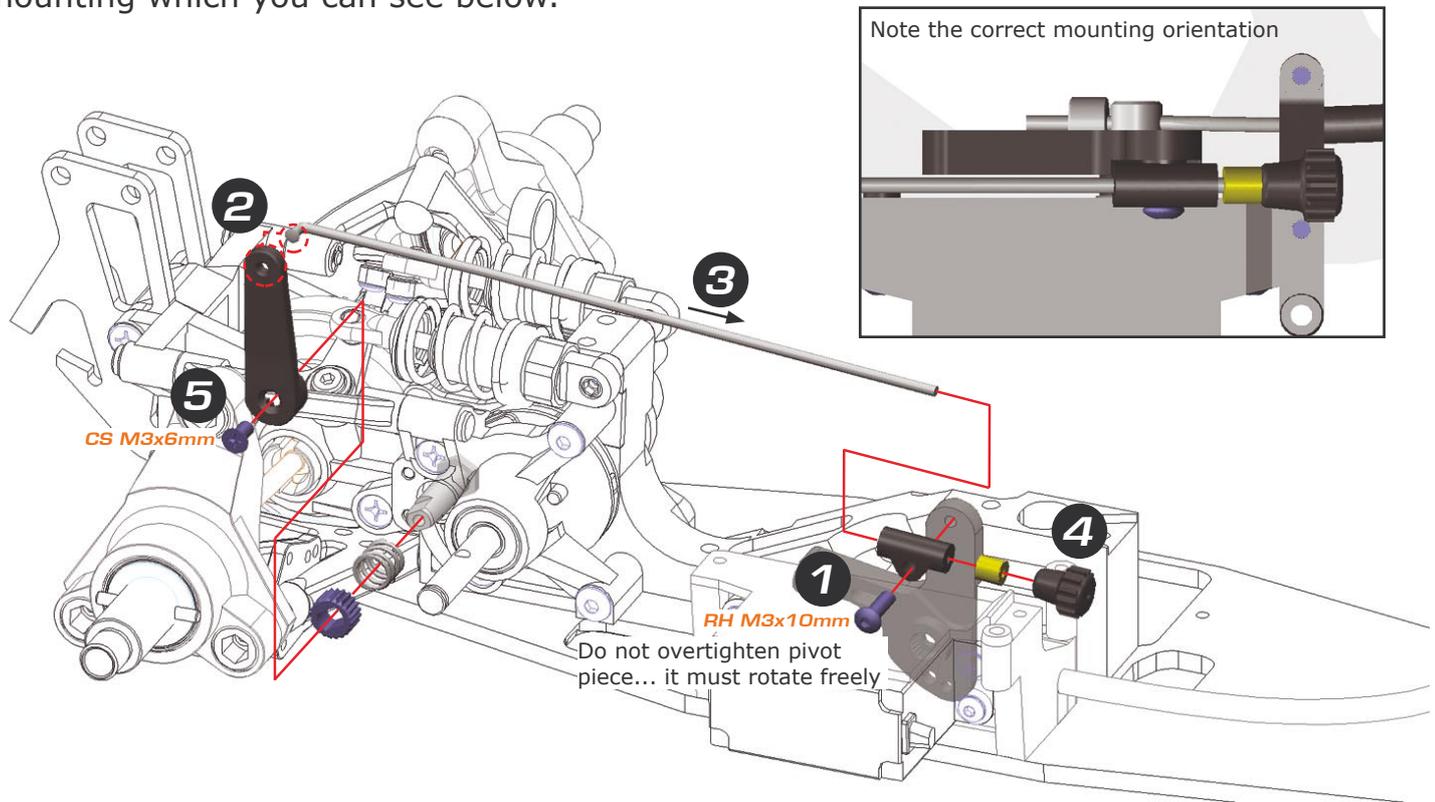

Page 24, step 6.4

The length of the anti-roll bar linkage should be set to 68mm, not 85mm.

Page 30, step 8.6

The screw used to mount the rear body mount plate to the chassis should be M4x8 and not M4x6 as shown.